

CHFA Capital Needs Assessment and Replacement Reserve Analysis

Prepared for:

Connecticut Housing Finance Authority
999 West Street
Rocky Hill, CT 06067

and

Recap Real Estate Advisors
38 Chauncy Street, Suite 600
Boston, MA 02111



38 Chauncy Street, Suite 600 | Boston, MA 02111
T: 617.338.9484 | F: 617.338.9422

on-site-insight.com



Pine Grove Manor

CHFA #92029D

Pine Grove Manor Co-operative
Enfield, CT

July 19, 2013

Final Report



Pine Grove Manor

15 Grove Street
Enfield, CT 06082



Pine Grove Manor

15 Grove Street
Enfield, CT 06082

Zone X = Outside the 500-year floodplain and
Outside the 1% and 0.2% annual chance floodplains

Executive Summary

Pine Grove Manor Cooperative

Enfield, CT

Pine Grove Manor Cooperative is a two building, eight unit residential co-operative development. The two four-unit buildings face each other across a traffic circle at the dead end of Grove Street. There is a one car garage and one driveway parking space at each unit. The buildings have vinyl siding and asphalt shingle roofing on steeply pitched gable roofs. The development includes 4 two-story two-bedroom units and 4 two-story three-bedroom units, one of which is designated as an accessible unit. Each unit has a full basement and a washer/dryer hookup on the first floor. Some tenants are using the basement as a TV room/study and/or another bedroom. These uses typically require the approval of the Building Inspector or other authority with jurisdiction. The development does not have any public facilities.

The development was constructed in 1991, and work since then has generally been on an as-needed basis. The exceptions include storm door replacement in 2011, the abandonment of the heat exchangers and replacement with unit hot water heaters, the replacement of two garage doors, and the re-lamping of four street lights. The kitchens, bathrooms, and finishes are refurbished on unit turnover. Domestic hot water heaters and smoke detectors are replaced as they fail.

Overall the development is in fair condition. The attached capital needs worksheets show the development faces significant capital needs in the near term. Based on these projections, the development is seen as requiring an adjustment to current replacement reserve funding and/or an infusion of additional capital, both of which were understood by On-Site Insight to be nominal or underfunded at the time this report was prepared.

Key findings identified by this assessment of Pine Grove Manor Co-operative include the following:

- Asphalt paving at the street, drives, and parking is shown with crack repair and sealcoating periodically over the plan.
- Asphalt paving at the street, drives, and parking is shown to be overlaid in Year 1.
- Replacement of rear walks, stoops, stairs and handrails are shown in Year 1, and concrete front walks and patios are shown mid-plan.
- All trip hazards are shown to be eliminated in Year 1.
- Rear wood stairs, ramps, and decks are shown to be replaced in Year 1 and again late in the plan.
- Cleaning of the storm drainage system piping and catch basins is shown in Year 1.
- Replacement of window wells is shown in Year 1.
- Replacement of asphalt shingle roofing is shown in Year 4 based on EUL and condition.
- Replacement of windows and vinyl siding and soffits is shown mid-plan.
- Replacement of unit entry doors, overhead garage doors, basement hatch doors is shown mid-plan.
- New roofing is shown early in the plan based on EUL and condition.
- Labeled fire-rated unit doors to the garage are shown to replace existing unlabeled doors in Year 1.
- New building fire alarm systems are shown in Year 1 and upgrades are shown late in the plan.
- Unit wall and ceiling finishes are in good condition. Painting at unit turn-over is funded from operating accounts.
- Unit hung and bi-fold doors are shown to be replaced mid-plan and vinyl flooring is shown to be replaced early and late in the plan.
- Unit living, bathroom, and kitchen accessibility improvements are shown in Year 1.
- Bathroom vinyl flooring, paint, fixtures, accessories, lights, and exhaust fans are shown to be replaced early in the plan based on EUL.

- Kitchen vinyl flooring, appliances, cabinets, counters, and sinks are shown to be replaced early in the plan based on EUL.
- The replacement of emergency call devices is shown Year 1 and late, and smoke and heat detectors are shown Year 1 and mid-plan.
- Replacement of thermostats, hot water baseboards, and domestic hot water heaters are shown early and late in the plan.
- Replacement of hot water boilers is shown mid-plan and removal of abandoned heat recovery units is shown in Year 1.

Additional Notes:

1. The Physical Assessment of the property was conducted on Thursday, June 27th, 2013. Additional information was provided to ON-SITE INSIGHT by site staff and others. OSI was represented on this assignment by Brian Ameche, Principal of Clearstory LLC. We would like to thank site staff for their assistance.
2. Cost estimates used in this assessment are based on data from *RS Means Facilities and Construction Cost Data*. These cost estimates have been applied uniformly across the entire study portfolio to help ensure consistency of future projections. Actual owner and/or site pricing could vary significantly.
3. Unless required by fire, safety, or accessibility codes, items are typically shown being replaced in kind and do not include any planned upgrades or potential upgrade opportunities.
4. Regular updates of this plan are recommended to ensure careful monitoring of major building systems and to adjust the program to accommodate unanticipated circumstances surrounding the buildings, operations, and/or occupants.
5. This report is delivered subject to the conditions on Appendix A, *Statement of Delivery*.



Typical cracking of asphalt paving in project drive.



Asphalt curb and concrete walk damage from snow removal is shown to be repaired in Year 1.



Asphalt failure in unit driveway. Asphalt curb is one of several typical trip hazards shown to be eliminated in Year 1.



Paver replacement to be coordinated with trip hazard removal in Year 1.



Riser height varies at concrete stair and is a typical trip hazard shown to be eliminated in Year 1. Concrete stoop, handrail and basement hatch and windows are all shown to be replaced in Year 1.



Deck and ramp repairs and painting at designated accessible unit are shown in Year 1.



Vinyl siding and soffits are shown to be replaced mid-plan based on EUL and condition.



Removal of rusted abandoned heat recovery system flue and patching the opening is shown in Year 1.



Storm water catch basins and piping are shown to be cleaned in Year 1.



Localized roof sheathing substrate failure. Asphalt roofing shingles are shown to be replaced early in the term.



Typical leaks at failed window well and basement window shown to be replaced in Year 1.



Typical living room in 3-bedroom apartment.



Typical kitchen in 3-bedroom apartments.



Typical dining area in 3-bedroom apartments.



Typical first and second floor full bathroom in 2 and 3-bedroom apartments.



Typical master bedroom in 3-bedroom apartments.




Typical second and third bedroom
in 3-bedroom apartment.



Typical living room in 2-bedroom apartments.



Typical kitchen in 2-bedroom apartments.

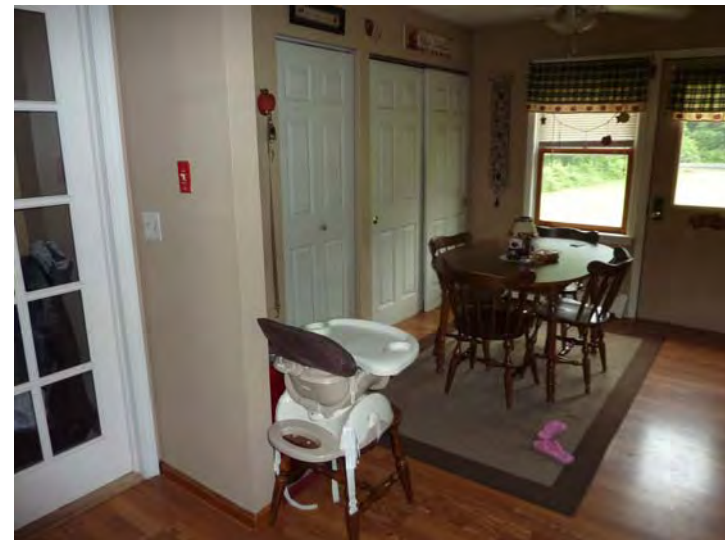

Typical dining area room in 2-bedroom apartments.



Typical half-bathroom in 2-bedroom apartments.



Typical bedroom in 2-bedroom apartments.



Cleaning of all grilles, fans, and duct work is shown in Year 1.



Abandoned white heat recovery system, Boiler, and blue domestic hot water tank in basement is typical for each apartment.

Comprehensive Capital Needs Assessment Schedule

Summary

| | |
|----------------------|-------------------------------|
| Owner Sponsor Name: | Pine Grove Manor Co-operative |
| Project Name: | Pine Grove Manor |
| Project City / Town: | Enfield |

| | |
|------------------------|-----------------|
| Current Year: | 2013 |
| Budget Effective Date: | January 1, 2013 |
| Report Date: | July 5, 2013 |

| | |
|-------------------------|-------|
| Number of Units: | 8 |
| Total Square Feet: | 9,402 |
| Default Inflation Rate: | 3.0% |

| | |
|--|-----|
| Beginning Replacement Reserve Balance: | \$0 |
| Annual Replacement Reserve Contribution: | \$0 |
| Additional Misc. Contribution: | \$0 |

| | Component | Total Planned Expenditures by Year | | | | | | | | | | | | | | | | | | | | | | |
|----|----------------------------------|------------------------------------|----------|-----------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|--------|----------------|
| | | Emergency | Deferred | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 | 10 | 11 | 12 | 13 | 14 | 15 | 16 | 17 | 18 | 19 | 20 | Revitalization |
| | | | | 2013 | 2014 | 2015 | 2016 | 2017 | 2018 | 2019 | 2020 | 2021 | 2022 | 2023 | 2024 | 2025 | 2026 | 2027 | 2028 | 2029 | 2030 | 2031 | 2032 | |
| 1 | Site Improvements | 0 | 12,000 | 90,625 | 0 | 0 | 0 | 0 | 7,355 | 0 | 0 | 8,614 | 0 | 16,589 | 0 | 17,109 | 0 | 0 | 56,623 | 0 | 0 | 0 | 0 | 0 |
| 2 | Building Exterior | 0 | 6,400 | 7,200 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 138,230 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 3 | Roofing | 0 | 0 | 4,000 | 0 | 0 | 55,018 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 4 | Lobby - Mail Area | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 5 | Community Room | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 6 | Common Hallways | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 7 | Common Stairways | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 8 | Common Laundry | 0 | 0 | 5,516 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 5,974 | 0 | 0 | 0 | 0 | 0 | 0 | 1,246 | 7,568 | 0 | 0 | 0 | 0 |
| 9 | Common Area Restrooms | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 10 | Building Boilers | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 11 | Building Mechanical | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 12 | Building Electrical | 0 | 30,000 | 30,000 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 52,605 | 0 |
| 13 | Building Elevator | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 14 | Building Structural | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 15 | Unit Living | 0 | 2,000 | 0 | 0 | 0 | 0 | 40,175 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 44,617 | 0 | 0 | 0 | 0 | 60,768 | 0 | 0 |
| 16 | Unit Kitchens | 0 | 2,000 | 2,800 | 11,956 | 34,373 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 4,362 | 8,601 | 0 | 0 | 0 | 0 |
| 17 | Unit Bathrooms | 0 | 3,000 | 0 | 0 | 0 | 87,697 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 13,228 | 0 | 0 | 0 | 0 | 6,810 | 0 | 0 |
| 18 | Unit Electrical | 0 | 0 | 13,040 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 14,299 | 0 | 0 | 0 | 0 | 3,739 | 0 | 0 | 0 | 0 | 0 |
| 19 | Unit Mechanical | 0 | 12,000 | 14,560 | 0 | 0 | 0 | 0 | 11,268 | 0 | 0 | 27,494 | 0 | 0 | 0 | 0 | 0 | 0 | 5,235 | 0 | 16,066 | 0 | 19,639 | 0 |
| 20 | Annual Planned Expenditures | 0 | 67,400 | 167,741 | 11,956 | 34,373 | 142,715 | 40,175 | 18,623 | 0 | 0 | 180,312 | 0 | 30,889 | 0 | 17,109 | 57,845 | 0 | 71,205 | 16,169 | 16,066 | 67,578 | 72,244 | 0 |
| 21 | Annual Provision (indexed at 3%) | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| 22 | Outside Capital | | | 1,055,000 | | | | | | | | | | | | | | | | | | | | |
| 23 | Cumulative Reserve Balance | 0 | (67,400) | 819,859 | 807,903 | 773,530 | 630,815 | 590,640 | 572,017 | 572,017 | 572,017 | 391,705 | 391,705 | 360,816 | 360,816 | 343,707 | 285,862 | 285,862 | 214,657 | 198,488 | 182,422 | 114,844 | 42,600 | |

Site Improvements

| | |
|-------------------------|-------|
| Number of Units: | 8 |
| Total Square Feet: | 9,402 |
| Default Inflation Rate: | 3.0% |

| | Component | Current Total Replacement Cost | Expected Annual Rate of Inflation | Current Age | Total Expected Useful Life | Initial Replacement Year | Planned Expenditures by Year | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
|----|---|--------------------------------|-----------------------------------|-------------|----------------------------|--------------------------|------------------------------|-----------|---------|----------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|--------|------|------|----------------|--|--|--|--|
| | | | | | | | Code | Emergency | Code | Deferred | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 | 10 | 11 | 12 | 13 | 14 | 15 | 16 | 17 | 18 | 19 | 20 | Revitalization | | | | |
| | | | | | | | | | | | 2013 | 2014 | 2015 | 2016 | 2017 | 2018 | 2019 | 2020 | 2021 | 2022 | 2023 | 2024 | 2025 | 2026 | 2027 | 2028 | 2029 | 2030 | 2031 | 2032 | | | | | |
| 1 | Asphalt Parking / Roadways | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 2 | Crack Fill / Sealant | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 3 | Concrete Sidewalks | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 4 | Bituminous Sidewalks | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 5 | Fencing | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 6 | Landscaping | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 7 | Dumpster Enclosures | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 8 | Storm Water System | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 9 | Site Lighting | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 10 | Fencing - Chain Link | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 11 | Retaining Walls | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 12 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 13 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 14 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 15 | Repair and Paint Wood Rear Stairs, Ramps and Decks | 12,000 | | 22 | 12 | 2013 | | | | 12,000 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 17,109 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 16 | Seal Joint Between Asphalt Curb and Concrete Walks | 4,560 | | 22 | 20 | 2013 | | | | 4,560 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 17 | Crackfill & Sealcoat Asphalt Street, Drives & Parking | 6,344 | | 1 | 5 | 2018 | | | | 0 | 0 | 0 | 0 | 0 | 7,355 | 0 | 0 | 0 | 0 | 8,526 | 0 | 0 | 0 | 0 | 9,884 | 0 | 0 | 0 | 0 | | | | | | |
| 18 | Asphalt Overlay Street, Drives & Parking | 38,065 | | 22 | 20 | 2013 | | | | 38,065 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 19 | Replace Front Concrete Walks and Patios | 6,800 | | 22 | 30 | 2021 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 8,614 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 20 | Replace Concete Walks, Rear Stoops, Stairs, Rails, Pavers | 36,000 | | 22 | 30 | 2013 | | | | 36,000 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 21 | Eliminate Trip Hazards at All Concrete and Asphalt Paving | 12,000 | | 1 | 1 | 2013 | | | 4 | 12,000 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 22 | Provide New Concrete Dumpster Pad and Screening | 6,000 | | 1 | 10 | 2013 | | | | 6,000 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 8,063 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 23 | Clean Storm Drainage System Piping and Catch Basins | 30,000 | | 22 | 15 | 2013 | | | 5 | 30,000 | 30,000 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 46,739 | 0 | 0 | 0 | 0 | | | | | | |
| 24 | Replace Window Wells | 16,000 | | 22 | 20 | 2013 | | | 5 | 16,000 | 16,000 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 25 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 26 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 27 | Annual Planned Expenditures | | | | | | 0 | 12,000 | 90,625 | 0 | 0 | 0 | 0 | 7,355 | 0 | 0 | 8,614 | 0 | 16,589 | 0 | 17,109 | 0 | 0 | 56,623 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 28 | Cumulative Reserve Balance | | | | | | 0 | (67,400) | 819,859 | 807,903 | 773,530 | 630,815 | 590,640 | 572,017 | 572,017 | 572,017 | 391,705 | 391,705 | 360,816 | 360,816 | 343,707 | 285,862 | 285,862 | 214,657 | 198,488 | 182,422 | 114,844 | 42,600 | | | | | | | |

Comprehensive Capital Needs Assessment Schedule

Roofing

| | |
|----------------------|-------------------------------|
| Owner Sponsor Name: | Pine Grove Manor Co-operative |
| Project Name: | Pine Grove Manor |
| Project City / Town: | Enfield |

| | |
|------------------------|-----------------|
| Current Year: | 2013 |
| Budget Effective Date: | January 1, 2013 |
| Report Date: | July 5, 2013 |

| | |
|-------------------------|-------|
| Number of Units: | 8 |
| Total Square Feet: | 9,402 |
| Default Inflation Rate: | 3.0% |

| | Component | Current Total Replacement Cost | Expected Annual Rate of Inflation | Current Age | Total Expected Useful Life | Initial Replacement Year | Planned Expenditures by Year | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
|----|--|--------------------------------|-----------------------------------|-------------|----------------------------|--------------------------|------------------------------|-----------|------|----------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|--------|----------------|--|--|--|--|
| | | | | | | | Code | Emergency | Code | Deferred | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 | 10 | 11 | 12 | 13 | 14 | 15 | 16 | 17 | 18 | 19 | 20 | Revitalization | | | | |
| | | | | | | | | | | | 2013 | 2014 | 2015 | 2016 | 2017 | 2018 | 2019 | 2020 | 2021 | 2022 | 2023 | 2024 | 2025 | 2026 | 2027 | 2028 | 2029 | 2030 | 2031 | 2032 | | | | | |
| 1 | Chimney | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 2 | Hatches / Skylights | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 3 | Penthouse / Machine Rooms | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 4 | Roof Railings | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 5 | Roof - Asphalt Shingle | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 6 | Roof - Built-up Tar and Gravel | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 7 | Roof - Single-ply Membrane | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 8 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 9 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 10 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 11 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 12 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 13 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 14 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 15 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 16 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 17 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 18 | Replace Asphalt Shingle Roofing | 50,349 | | 22 | 25 | 2016 | | | | | 0 | 0 | 0 | 55,018 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 19 | Remove/Patch at Rusted Heat Recovery System Stacks | 4,000 | | 1 | 1 | 2013 | | | | | 4,000 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 20 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 21 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 22 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 23 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 24 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 25 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 26 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 27 | Annual Planned Expenditures | | | | | | | 0 | | 0 | 4,000 | 0 | 0 | 55,018 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 28 | Cumulative Reserve Balance | | | | | | | 0 | | (67,400) | 819,859 | 807,903 | 773,530 | 630,815 | 590,640 | 572,017 | 572,017 | 572,017 | 391,705 | 391,705 | 360,816 | 360,816 | 343,707 | 285,862 | 285,862 | 214,657 | 198,488 | 182,422 | 114,844 | 42,600 | | | | | |

Building Exterior

| | |
|-------------------------|-------|
| Number of Units: | 8 |
| Total Square Feet: | 9,402 |
| Default Inflation Rate: | 3.0% |

| | Component | Current Total Replacement Cost | Expected Annual Rate of Inflation | Current Age | Total Expected Useful Life | Initial Replacement Year | Planned Expenditures by Year | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
|----|--|--------------------------------|-----------------------------------|-------------|----------------------------|--------------------------|------------------------------|-----------|---------|----------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|--------|------|------|----------------|--|--|--|--|
| | | | | | | | Code | Emergency | Code | Deferred | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 | 10 | 11 | 12 | 13 | 14 | 15 | 16 | 17 | 18 | 19 | 20 | Revitalization | | | | |
| | | | | | | | | | | | 2013 | 2014 | 2015 | 2016 | 2017 | 2018 | 2019 | 2020 | 2021 | 2022 | 2023 | 2024 | 2025 | 2026 | 2027 | 2028 | 2029 | 2030 | 2031 | 2032 | | | | | |
| 1 | Exterior Doors | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 2 | Glass Doors (Sliders) | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 3 | Exterior Walls - Masonry | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 4 | Exterior Walls - EIFS | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 5 | Ext. Walls - Vinyl Siding | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 6 | Ext. Walls - Wood Siding | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 7 | Windows | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 8 | Exterior Soffits and Fascia | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 9 | Caulking | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 10 | Unit Balconies / Decks | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 11 | Railings | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 12 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 13 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 14 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 15 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 16 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 17 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 18 | Replce Windows | 18,460 | | 22 | 30 | 2021 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 23,385 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 19 | Replace Overhead Garage Doors | 6,400 | | 22 | 30 | 2021 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 8,107 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 20 | Replace Steel Exterior Entry Doors | 9,600 | | 22 | 30 | 2021 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 12,161 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 21 | Replace Vinyl Soffits | 3,300 | | 22 | 30 | 2021 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 4,180 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 22 | Replace Vinyl Siding | 66,560 | | 22 | 30 | 2021 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 84,316 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 23 | Replace Basement Hatch Doors | 4,800 | | 22 | 30 | 2021 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 6,080 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 24 | Replace Basement Window Wells and Windows | 3,200 | | 1 | 1 | 2013 | | 5 | 3,200 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 25 | Replace A/C Unit Sleeves | 7,200 | | 22 | 20 | 2013 | | | | 7,200 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 26 | New Labelled Fire-rated Unit Doors to Garage | 3,200 | | 1 | 1 | 2013 | | 5 | 3,200 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 27 | Annual Planned Expenditures | | | | | | 0 | 6,400 | 7,200 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 138,230 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 28 | Cumulative Reserve Balance | | | | | | 0 | (67,400) | 819,859 | 807,903 | 773,530 | 630,815 | 590,640 | 572,017 | 572,017 | 572,017 | 391,705 | 391,705 | 360,816 | 360,816 | 343,707 | 285,862 | 285,862 | 214,657 | 198,488 | 182,422 | 114,844 | 42,600 | | | | | | | |

Comprehensive Capital Needs Assessment Schedule

Lobby / Mail Area

| | |
|----------------------|-------------------------------|
| Owner Sponsor Name: | Pine Grove Manor Co-operative |
| Project Name: | Pine Grove Manor |
| Project City / Town: | Enfield |

| | |
|------------------------|-----------------|
| Current Year: | 2013 |
| Budget Effective Date: | January 1, 2013 |
| Report Date: | July 5, 2013 |

| | |
|-------------------------|-------|
| Number of Units: | 8 |
| Total Square Feet: | 9,402 |
| Default Inflation Rate: | 3.0% |

| | Component | Current Total Replacement Cost | Expected Annual Rate of Inflation | Current Age | Total Expected Useful Life | Initial Replacement Year | Planned Expenditures by Year | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
|----|-----------------------------|--------------------------------|-----------------------------------|-------------|----------------------------|--------------------------|------------------------------|-----------|------|----------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|--------|----------------|--|--|--|--|
| | | | | | | | Code | Emergency | Code | Deferred | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 | 10 | 11 | 12 | 13 | 14 | 15 | 16 | 17 | 18 | 19 | 20 | Revitalization | | | | |
| | | | | | | | | | | | 2013 | 2014 | 2015 | 2016 | 2017 | 2018 | 2019 | 2020 | 2021 | 2022 | 2023 | 2024 | 2025 | 2026 | 2027 | 2028 | 2029 | 2030 | 2031 | 2032 | | | | | |
| 1 | Walls | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 2 | Ceilings | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 3 | Floors | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 4 | Mail Facilities | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 5 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 6 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 7 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 8 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 9 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 10 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 11 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 12 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 13 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 14 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 15 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 16 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 17 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 18 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 19 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 20 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 21 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 22 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 23 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 24 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 25 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 26 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 27 | Annual Planned Expenditures | | | | | | | 0 | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 28 | Cumulative Reserve Balance | | | | | | | 0 | | (67,400) | 819,859 | 807,903 | 773,530 | 630,815 | 590,640 | 572,017 | 572,017 | 572,017 | 391,705 | 391,705 | 360,816 | 360,816 | 343,707 | 285,862 | 285,862 | 214,657 | 198,488 | 182,422 | 114,844 | 42,600 | | | | | |

Comprehensive Capital Needs Assessment Schedule

Community Room

| | |
|----------------------|-------------------------------|
| Owner Sponsor Name: | Pine Grove Manor Co-operative |
| Project Name: | Pine Grove Manor |
| Project City / Town: | Enfield |

| | |
|------------------------|-----------------|
| Current Year: | 2013 |
| Budget Effective Date: | January 1, 2013 |
| Report Date: | July 5, 2013 |

| | |
|-------------------------|-------|
| Number of Units: | 8 |
| Total Square Feet: | 9,402 |
| Default Inflation Rate: | 3.0% |

| | Component | Current Total Replacement Cost | Expected Annual Rate of Inflation | Current Age | Total Expected Useful Life | Initial Replacement Year | Planned Expenditures by Year | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
|----|-----------------------------|--------------------------------|-----------------------------------|-------------|----------------------------|--------------------------|------------------------------|-----------|------|----------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|--------|----------------|--|--|--|--|
| | | | | | | | Code | Emergency | Code | Deferred | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 | 10 | 11 | 12 | 13 | 14 | 15 | 16 | 17 | 18 | 19 | 20 | Revitalization | | | | |
| | | | | | | | | | | | 2013 | 2014 | 2015 | 2016 | 2017 | 2018 | 2019 | 2020 | 2021 | 2022 | 2023 | 2024 | 2025 | 2026 | 2027 | 2028 | 2029 | 2030 | 2031 | 2032 | | | | | |
| 1 | Floor | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 2 | Kitchen Cabinets / Sink | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 3 | Kitchen Appliances | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 4 | Furnishings | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 5 | Refrigerator | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 6 | Range | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 7 | Painting - Walls | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 8 | Range Hood | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 9 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 10 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 11 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 12 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 13 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 14 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 15 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 16 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 17 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 18 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 19 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 20 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 21 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 22 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 23 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 24 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 25 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 26 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 27 | Annual Planned Expenditures | | | | | | | 0 | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 28 | Cumulative Reserve Balance | | | | | | | 0 | | (67,400) | 819,859 | 807,903 | 773,530 | 630,815 | 590,640 | 572,017 | 572,017 | 572,017 | 391,705 | 391,705 | 360,816 | 360,816 | 343,707 | 285,862 | 285,862 | 214,657 | 198,488 | 182,422 | 114,844 | 42,600 | | | | | |

Common Hallways

| | |
|-------------------------|-------|
| Number of Units: | 8 |
| Total Square Feet: | 9,402 |
| Default Inflation Rate: | 3.0% |

92029D 13433 - Pine Grove Manor - PRELIM SS 7/7/2013

Common Stairways

| | |
|-------------------------|-------|
| Number of Units: | 8 |
| Total Square Feet: | 9,402 |
| Default Inflation Rate: | 3.0% |

Page 17

Common Laundry

| | |
|-------------------------|-------|
| Number of Units: | 8 |
| Total Square Feet: | 9,402 |
| Default Inflation Rate: | 3.0% |

Pine Grove Manor • Capital Needs Assessment • © On-Site Insights

Common Area Restrooms

| | |
|-------------------------|-------|
| Number of Units: | 8 |
| Total Square Feet: | 9,402 |
| Default Inflation Rate: | 3.0% |

Page 19

Comprehensive Capital Needs Assessment Schedule

Building Boilers

| | |
|----------------------|-------------------------------|
| Owner Sponsor Name: | Pine Grove Manor Co-operative |
| Project Name: | Pine Grove Manor |
| Project City / Town: | Enfield |

| | |
|------------------------|-----------------|
| Current Year: | 2013 |
| Budget Effective Date: | January 1, 2013 |
| Report Date: | July 5, 2013 |

| | |
|-------------------------|-------|
| Number of Units: | 8 |
| Total Square Feet: | 9,402 |
| Default Inflation Rate: | 3.0% |

| | Component | Current Total Replacement Cost | Expected Annual Rate of Inflation | Current Age | Total Expected Useful Life | Initial Replacement Year | Planned Expenditures by Year | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
|----|-----------------------------|--------------------------------|-----------------------------------|-------------|----------------------------|--------------------------|------------------------------|-----------|---------|----------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|--------|------|------|----------------|--|--|--|--|
| | | | | | | | Code | Emergency | Code | Deferred | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 | 10 | 11 | 12 | 13 | 14 | 15 | 16 | 17 | 18 | 19 | 20 | Revitalization | | | | |
| | | | | | | | | | | | 2013 | 2014 | 2015 | 2016 | 2017 | 2018 | 2019 | 2020 | 2021 | 2022 | 2023 | 2024 | 2025 | 2026 | 2027 | 2028 | 2029 | 2030 | 2031 | 2032 | | | | | |
| 1 | Boilers / Warm Air Furnaces | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 2 | Boiler Operating Controls | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 3 | Pneumatic Systems Controls | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 4 | Condensate & Feed Water | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 5 | Fuel Oil Storage | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 6 | Fuel Oil Transfer System | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 7 | Fuel Exhaust | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 8 | Combustion Air | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 9 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 10 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 11 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 12 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 13 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 14 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 15 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 16 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 17 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 18 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 19 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 20 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 21 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 22 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 23 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 24 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 25 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 26 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 27 | Annual Planned Expenditures | | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 28 | Cumulative Reserve Balance | | | | | | 0 | (67,400) | 819,859 | 807,903 | 773,530 | 630,815 | 590,640 | 572,017 | 572,017 | 572,017 | 391,705 | 391,705 | 360,816 | 360,816 | 343,707 | 285,862 | 285,862 | 214,657 | 198,488 | 182,422 | 114,844 | 42,600 | | | | | | | |

Comprehensive Capital Needs Assessment Schedule

Building Mechanical

| | |
|----------------------|-------------------------------|
| Owner Sponsor Name: | Pine Grove Manor Co-operative |
| Project Name: | Pine Grove Manor |
| Project City / Town: | Enfield |

| | |
|------------------------|-----------------|
| Current Year: | 2013 |
| Budget Effective Date: | January 1, 2013 |
| Report Date: | July 5, 2013 |

| | |
|-------------------------|-------|
| Number of Units: | 8 |
| Total Square Feet: | 9,402 |
| Default Inflation Rate: | 3.0% |

| | Component | Current Total Replacement Cost | Expected Annual Rate of Inflation | Current Age | Total Expected Useful Life | Initial Replacement Year | Planned Expenditures by Year | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
|----|---------------------------------|--------------------------------|-----------------------------------|-------------|----------------------------|--------------------------|------------------------------|-----------|---------|----------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|--------|------|------|----------------|--|--|--|--|
| | | | | | | | Code | Emergency | Code | Deferred | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 | 10 | 11 | 12 | 13 | 14 | 15 | 16 | 17 | 18 | 19 | 20 | Revitalization | | | | |
| | | | | | | | | | | | 2013 | 2014 | 2015 | 2016 | 2017 | 2018 | 2019 | 2020 | 2021 | 2022 | 2023 | 2024 | 2025 | 2026 | 2027 | 2028 | 2029 | 2030 | 2031 | 2032 | | | | | |
| 1 | Building Fire Suppression | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 2 | Building Heating Distribution | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 3 | Domestic Hot / Cold Water Dist. | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 4 | Building Sanitary Waste & Vent. | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 5 | Make-Up Air Unit | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 6 | Ventalation & Exhaust | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 7 | Air Handling Units | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 8 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 9 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 10 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 11 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 12 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 13 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 14 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 15 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 16 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 17 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 18 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 19 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 20 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 21 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 22 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 23 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 24 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 25 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 26 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 27 | Annual Planned Expenditures | | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 28 | Cumulative Reserve Balance | | | | | | 0 | (67,400) | 819,859 | 807,903 | 773,530 | 630,815 | 590,640 | 572,017 | 572,017 | 572,017 | 391,705 | 391,705 | 360,816 | 360,816 | 343,707 | 285,862 | 285,862 | 214,657 | 198,488 | 182,422 | 114,844 | 42,600 | | | | | | | |

Comprehensive Capital Needs Assessment Schedule

Building Electrical

| | |
|----------------------|-------------------------------|
| Owner Sponsor Name: | Pine Grove Manor Co-operative |
| Project Name: | Pine Grove Manor |
| Project City / Town: | Enfield |

| | |
|------------------------|-----------------|
| Current Year: | 2013 |
| Budget Effective Date: | January 1, 2013 |
| Report Date: | July 5, 2013 |

| | |
|-------------------------|-------|
| Number of Units: | 8 |
| Total Square Feet: | 9,402 |
| Default Inflation Rate: | 3.0% |

| | Component | Current Total Replacement Cost | Expected Annual Rate of Inflation | Current Age | Total Expected Useful Life | Initial Replacement Year | Planned Expenditures by Year | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
|----|-------------------------------------|--------------------------------|-----------------------------------|-------------|----------------------------|--------------------------|------------------------------|-----------|---------|----------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|--------|--------|------|----------------|--|--|--|--|
| | | | | | | | Code | Emergency | Code | Deferred | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 | 10 | 11 | 12 | 13 | 14 | 15 | 16 | 17 | 18 | 19 | 20 | Revitalization | | | | |
| | | | | | | | | | | | 2013 | 2014 | 2015 | 2016 | 2017 | 2018 | 2019 | 2020 | 2021 | 2022 | 2023 | 2024 | 2025 | 2026 | 2027 | 2028 | 2029 | 2030 | 2031 | 2032 | | | | | |
| 1 | Switch Gear | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 2 | Emergency Generator | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 3 | Smoke / Fire Detection | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 4 | Signaling / Communication | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 5 | Building Wiring | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 6 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 7 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 8 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 9 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 10 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 11 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 12 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 13 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 14 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 15 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 16 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 17 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 18 | Provide Building Fire Alarm Systems | 30,000 | | 1 | 20 | 2013 | | 5 | 30,000 | 30,000 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 52,605 | | | | | | |
| 19 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 20 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 21 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 22 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 23 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 24 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 25 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 26 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 27 | Annual Planned Expenditures | | | | | | 0 | 30,000 | 30,000 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 52,605 | 0 | | | | | | |
| 28 | Cumulative Reserve Balance | | | | | | 0 | (67,400) | 819,859 | 807,903 | 773,530 | 630,815 | 590,640 | 572,017 | 572,017 | 572,017 | 391,705 | 391,705 | 360,816 | 360,816 | 343,707 | 285,862 | 285,862 | 214,657 | 198,488 | 182,422 | 114,844 | 42,600 | | | | | | | |

Comprehensive Capital Needs Assessment Schedule

Building Elevator

| | |
|----------------------|-------------------------------|
| Owner Sponsor Name: | Pine Grove Manor Co-operative |
| Project Name: | Pine Grove Manor |
| Project City / Town: | Enfield |

| | |
|------------------------|-----------------|
| Current Year: | 2013 |
| Budget Effective Date: | January 1, 2013 |
| Report Date: | July 5, 2013 |

| | |
|-------------------------|-------|
| Number of Units: | 8 |
| Total Square Feet: | 9,402 |
| Default Inflation Rate: | 3.0% |

| | Component | Current Total Replacement Cost | Expected Annual Rate of Inflation | Current Age | Total Expected Useful Life | Initial Replacement Year | Planned Expenditures by Year | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
|----|-----------------------------|--------------------------------|-----------------------------------|-------------|----------------------------|--------------------------|------------------------------|-----------|---------|----------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|--------|------|------|----------------|--|--|--|--|
| | | | | | | | Code | Emergency | Code | Deferred | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 | 10 | 11 | 12 | 13 | 14 | 15 | 16 | 17 | 18 | 19 | 20 | Revitalization | | | | |
| | | | | | | | | | | | 2013 | 2014 | 2015 | 2016 | 2017 | 2018 | 2019 | 2020 | 2021 | 2022 | 2023 | 2024 | 2025 | 2026 | 2027 | 2028 | 2029 | 2030 | 2031 | 2032 | | | | | |
| 1 | Shafts and Doorways | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 2 | Cabs | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 3 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 4 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 5 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 6 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 7 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 8 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 9 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 10 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 11 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 12 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 13 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 14 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 15 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 16 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 17 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 18 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 19 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 20 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 21 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 22 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 23 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 24 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 25 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 26 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 27 | Annual Planned Expenditures | | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 28 | Cumulative Reserve Balance | | | | | | 0 | (67,400) | 819,859 | 807,903 | 773,530 | 630,815 | 590,640 | 572,017 | 572,017 | 572,017 | 391,705 | 391,705 | 360,816 | 360,816 | 343,707 | 285,862 | 285,862 | 214,657 | 198,488 | 182,422 | 114,844 | 42,600 | | | | | | | |

Comprehensive Capital Needs Assessment Schedule

Building Structural

| | |
|----------------------|-------------------------------|
| Owner Sponsor Name: | Pine Grove Manor Co-operative |
| Project Name: | Pine Grove Manor |
| Project City / Town: | Enfield |

| | |
|------------------------|-----------------|
| Current Year: | 2013 |
| Budget Effective Date: | January 1, 2013 |
| Report Date: | July 5, 2013 |

| | |
|-------------------------|-------|
| Number of Units: | 8 |
| Total Square Feet: | 9,402 |
| Default Inflation Rate: | 3.0% |

| | Component | Current Total Replacement Cost | Expected Annual Rate of Inflation | Current Age | Total Expected Useful Life | Initial Replacement Year | Planned Expenditures by Year | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
|----|-----------------------------|--------------------------------|-----------------------------------|-------------|----------------------------|--------------------------|------------------------------|-----------|------|----------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|--------|----------------|--|--|--|--|
| | | | | | | | Code | Emergency | Code | Deferred | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 | 10 | 11 | 12 | 13 | 14 | 15 | 16 | 17 | 18 | 19 | 20 | Revitalization | | | | |
| | | | | | | | | | | | 2013 | 2014 | 2015 | 2016 | 2017 | 2018 | 2019 | 2020 | 2021 | 2022 | 2023 | 2024 | 2025 | 2026 | 2027 | 2028 | 2029 | 2030 | 2031 | 2032 | | | | | |
| 1 | Foundation / Floor Slab | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 2 | Framing & Columns | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 3 | Steel | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 4 | Wood Framing | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 5 | Masonry Bearing Walls | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 6 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 7 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 8 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 9 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 10 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 11 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 12 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 13 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 14 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 15 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 16 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 17 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 18 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 19 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 20 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 21 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 22 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 23 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 24 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 25 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 26 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 27 | Annual Planned Expenditures | | | | | | | 0 | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 28 | Cumulative Reserve Balance | | | | | | | 0 | | (67,400) | 819,859 | 807,903 | 773,530 | 630,815 | 590,640 | 572,017 | 572,017 | 572,017 | 391,705 | 391,705 | 360,816 | 360,816 | 343,707 | 285,862 | 285,862 | 214,657 | 198,488 | 182,422 | 114,844 | 42,600 | | | | | |

Comprehensive Capital Needs Assessment Schedule

Unit Living

| | |
|----------------------|-------------------------------|
| Owner Sponsor Name: | Pine Grove Manor Co-operative |
| Project Name: | Pine Grove Manor |
| Project City / Town: | Enfield |

| | |
|------------------------|-----------------|
| Current Year: | 2013 |
| Budget Effective Date: | January 1, 2013 |
| Report Date: | July 5, 2013 |

| | |
|-------------------------|-------|
| Number of Units: | 8 |
| Total Square Feet: | 9,402 |
| Default Inflation Rate: | 3.0% |

| | Component | Current Total Replacement Cost | Expected Annual Rate of Inflation | Current Age | Total Expected Useful Life | Initial Replacement Year | Planned Expenditures by Year | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
|----|-----------------------------|--------------------------------|-----------------------------------|-------------|----------------------------|--------------------------|------------------------------|-----------|----------|----------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|--------|------|----------------|--|--|--|--|
| | | | | | | | Code | Emergency | Code | Deferred | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 | 10 | 11 | 12 | 13 | 14 | 15 | 16 | 17 | 18 | 19 | 20 | Revitalization | | | | |
| | | | | | | | | | | | 2013 | 2014 | 2015 | 2016 | 2017 | 2018 | 2019 | 2020 | 2021 | 2022 | 2023 | 2024 | 2025 | 2026 | 2027 | 2028 | 2029 | 2030 | 2031 | 2032 | | | | | |
| 1 | Interior Doors | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 2 | Walls | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 3 | Ceilings | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 4 | Interior Stairs | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 5 | Floors | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 6 | AC Sleeve | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 7 | Electrical Outlets | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 8 | Lighting Fixtures | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 9 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 10 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 11 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 12 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 13 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 14 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 15 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 16 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 17 | New Vinyl Floors | 35,695 | | varies | 15 | 2017 | | | | | 0 | 0 | 0 | 0 | 40,175 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 60,768 | 0 | | | | | | |
| 18 | New Interior Hung Doors | 5,280 | | 22 | 35 | 2026 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 7,754 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 19 | New Interior Bi-fold Doors | 25,102 | | 22 | 35 | 2026 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 36,863 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 20 | Accessibility Improvements | 2,000 | | 1 | 1 | 2013 | | | 4 | 2,000 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 21 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 22 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 23 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 24 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 25 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 26 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 27 | Annual Planned Expenditures | | | | | | 0 | | 2,000 | 0 | 0 | 0 | 0 | 40,175 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 44,617 | 0 | 0 | 0 | 0 | 60,768 | 0 | 0 | | | | | |
| 28 | Cumulative Reserve Balance | | | | | | 0 | | (67,400) | 819,859 | 807,903 | 773,530 | 630,815 | 590,640 | 572,017 | 572,017 | 572,017 | 391,705 | 391,705 | 360,816 | 360,816 | 343,707 | 285,862 | 285,862 | 214,657 | 198,488 | 182,422 | 114,844 | 42,600 | | | | | | |

Comprehensive Capital Needs Assessment Schedule

Unit Bathrooms

| | |
|----------------------|-------------------------------|
| Owner Sponsor Name: | Pine Grove Manor Co-operative |
| Project Name: | Pine Grove Manor |
| Project City / Town: | Enfield |

| | |
|------------------------|-----------------|
| Current Year: | 2013 |
| Budget Effective Date: | January 1, 2013 |
| Report Date: | July 5, 2013 |

| | |
|-------------------------|-------|
| Number of Units: | 8 |
| Total Square Feet: | 9,402 |
| Default Inflation Rate: | 3.0% |

| | Component | Current Total Replacement Cost | Expected Annual Rate of Inflation | Current Age | Total Expected Useful Life | Initial Replacement Year | Planned Expenditures by Year | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
|----|---|--------------------------------|-----------------------------------|-------------|----------------------------|--------------------------|------------------------------|-----------|------|----------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|--------|----------------|--|--|--|--|
| | | | | | | | Code | Emergency | Code | Deferred | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 | 10 | 11 | 12 | 13 | 14 | 15 | 16 | 17 | 18 | 19 | 20 | Revitalization | | | | |
| | | | | | | | | | | | 2013 | 2014 | 2015 | 2016 | 2017 | 2018 | 2019 | 2020 | 2021 | 2022 | 2023 | 2024 | 2025 | 2026 | 2027 | 2028 | 2029 | 2030 | 2031 | 2032 | | | | | |
| 1 | Walls | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 2 | Ceiling | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 3 | Lavatory / Vanity | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 4 | Toilet | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 5 | Tub / Surround | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 6 | Floor | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 7 | Accessories | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 8 | Lighting Features | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 9 | Exhaust Fan | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 10 | GFI Outlet | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 11 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 12 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 13 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 14 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 15 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 16 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 17 | New Toilet, Vanity, Sink and Mixing Valve | 23,920 | | 22 | 25 | 2016 | | | | | 0 | 0 | 0 | 26,138 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 18 | New Tub, Surround and Mixing Valve | 32,320 | | 22 | 25 | 2016 | | | | | 0 | 0 | 0 | 35,317 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 19 | New Accessories | 6,688 | | 22 | 25 | 2016 | | | | | 0 | 0 | 0 | 7,308 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 20 | New Exhaust Fans | 2,400 | | 22 | 25 | 2016 | | | | | 0 | 0 | 0 | 2,623 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 21 | New Light | 1,920 | | 22 | 25 | 2016 | | | | | 0 | 0 | 0 | 2,098 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 22 | New Vinyl Floor | 4,000 | | varies | 15 | 2016 | | | | | 0 | 0 | 0 | 4,371 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 6,810 | 0 | | | | | |
| 23 | Paint Walls | 8,511 | | varies | 10 | 2016 | | | | | 0 | 0 | 0 | 9,301 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 12,499 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 24 | Paint Ceilings | 496 | | varies | 10 | 2016 | | | | | 0 | 0 | 0 | 542 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 728 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 25 | Accessibility Improvements | 3,000 | | 1 | 1 | 2013 | | | 4 | 3,000 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 26 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 27 | Annual Planned Expenditures | | | | | | | 0 | | 3,000 | 0 | 0 | 0 | 87,697 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 13,228 | 0 | 0 | 0 | 0 | 6,810 | 0 | 0 | | | | |
| 28 | Cumulative Reserve Balance | | | | | | | 0 | | (67,400) | 819,859 | 807,903 | 773,530 | 630,815 | 590,640 | 572,017 | 572,017 | 572,017 | 391,705 | 391,705 | 360,816 | 360,816 | 343,707 | 285,862 | 285,862 | 214,657 | 198,488 | 182,422 | 114,844 | 42,600 | | | | | |

Comprehensive Capital Needs Assessment Schedule

Unit Kitchens

| | |
|----------------------|-------------------------------|
| Owner Sponsor Name: | Pine Grove Manor Co-operative |
| Project Name: | Pine Grove Manor |
| Project City / Town: | Enfield |

| | |
|------------------------|-----------------|
| Current Year: | 2013 |
| Budget Effective Date: | January 1, 2013 |
| Report Date: | July 5, 2013 |

| | |
|-------------------------|-------|
| Number of Units: | 8 |
| Total Square Feet: | 9,402 |
| Default Inflation Rate: | 3.0% |

| | Component | Current Total Replacement Cost | Expected Annual Rate of Inflation | Current Age | Total Expected Useful Life | Initial Replacement Year | Planned Expenditures by Year | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
|----|-----------------------------|--------------------------------|-----------------------------------|-------------|----------------------------|--------------------------|------------------------------|-----------|----------|----------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|--------|----------------|--|--|--|--|
| | | | | | | | Code | Emergency | Code | Deferred | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 | 10 | 11 | 12 | 13 | 14 | 15 | 16 | 17 | 18 | 19 | 20 | Revitalization | | | | |
| | | | | | | | | | | | 2013 | 2014 | 2015 | 2016 | 2017 | 2018 | 2019 | 2020 | 2021 | 2022 | 2023 | 2024 | 2025 | 2026 | 2027 | 2028 | 2029 | 2030 | 2031 | 2032 | | | | | |
| 1 | Walls | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 2 | Ceilings | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 3 | Floors | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 4 | Cabinets | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 5 | Countertops | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 6 | Sink | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 7 | Kitchen Exhaust Fan | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 8 | GFI Outlet | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 9 | Vent Hood | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 10 | Refrigerators | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 11 | Stove | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 12 | Range | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 13 | Dishwasher | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 14 | Disposal | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 15 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 16 | Other | | | | | 2013 | | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 17 | New Vinyl Floors | 2,800 | | varies | 15 | 2013 | | | | | 2,800 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 4,362 | 0 | 0 | 0 | 0 | | | | | |
| 18 | Refrigerators | 5,360 | | varies | 15 | 2014 | | | | | 0 | 5,521 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 8,601 | 0 | 0 | 0 | | | | | | |
| 19 | Cabinets/Countertop/Sink | 32,400 | | 22 | 25 | 2015 | | | | | 0 | 0 | 34,373 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 20 | Range | 4,000 | | varies | 20 | 2014 | | | | | 0 | 4,120 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 21 | Rangehood | 2,248 | | varies | 20 | 2014 | | | | | 0 | 2,315 | 0 | 0 | 0 | 0 | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 22 | Accessibility Improvements | 2,000 | | 1 | 1 | 2013 | | | 4 | 2,000 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 23 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 24 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 25 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 26 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 27 | Annual Planned Expenditures | | | | | | 0 | | 2,000 | | 2,800 | 11,956 | 34,373 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 4,362 | 8,601 | 0 | 0 | 0 | 0 | | | | |
| 28 | Cumulative Reserve Balance | | | | | | 0 | | (67,400) | | 819,859 | 807,903 | 773,530 | 630,815 | 590,640 | 572,017 | 572,017 | 572,017 | 391,705 | 391,705 | 360,816 | 360,816 | 343,707 | 285,862 | 285,862 | 214,657 | 198,488 | 182,422 | 114,844 | 42,600 | | | | | |

Comprehensive Capital Needs Assessment Schedule

Unit Electrical

| | |
|----------------------|-------------------------------|
| Owner Sponsor Name: | Pine Grove Manor Co-operative |
| Project Name: | Pine Grove Manor |
| Project City / Town: | Enfield |

| | |
|------------------------|-----------------|
| Current Year: | 2013 |
| Budget Effective Date: | January 1, 2013 |
| Report Date: | July 5, 2013 |

| | |
|-------------------------|-------|
| Number of Units: | 8 |
| Total Square Feet: | 9,402 |
| Default Inflation Rate: | 3.0% |

| | Component | Current Total Replacement Cost | Expected Annual Rate of Inflation | Current Age | Total Expected Useful Life | Initial Replacement Year | Planned Expenditures by Year | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
|----|------------------------------------|--------------------------------|-----------------------------------|-------------|----------------------------|--------------------------|------------------------------|-----------|------|----------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|--------|----------------|--|--|--|--|
| | | | | | | | Code | Emergency | Code | Deferred | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 | 10 | 11 | 12 | 13 | 14 | 15 | 16 | 17 | 18 | 19 | 20 | Revitalization | | | | |
| | | | | | | | | | | | 2013 | 2014 | 2015 | 2016 | 2017 | 2018 | 2019 | 2020 | 2021 | 2022 | 2023 | 2024 | 2025 | 2026 | 2027 | 2028 | 2029 | 2030 | 2031 | 2032 | | | | | |
| 1 | Emergency Call System | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 2 | Electrical Panel | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 3 | Smoke Detectors | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 4 | Intercom | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 5 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 6 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 7 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 8 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 9 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 10 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 11 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 12 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 13 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 14 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 15 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 16 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 17 | Emergency Call For Aid System | 2,400 | | 22 | 15 | 2013 | | | | 2,400 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 3,739 | 0 | 0 | 0 | 0 | | | | | |
| 18 | Smoke Detectors and Heat Detectors | 10,640 | | varies | 10 | 2013 | | | | 10,640 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 14,299 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | |
| 19 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 20 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 21 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 22 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 23 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 24 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 25 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 26 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 27 | Annual Planned Expenditures | | | | | | | 0 | | 0 | 13,040 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 14,299 | 0 | 0 | 0 | 0 | 3,739 | 0 | 0 | 0 | 0 | 0 | | | | |
| 28 | Cumulative Reserve Balance | | | | | | | 0 | | (67,400) | 819,859 | 807,903 | 773,530 | 630,815 | 590,640 | 572,017 | 572,017 | 572,017 | 391,705 | 391,705 | 360,816 | 360,816 | 343,707 | 285,862 | 285,862 | 214,657 | 198,488 | 182,422 | 114,844 | 42,600 | | | | | |

Unit Mechanical

| | |
|-------------------------|-------|
| Number of Units: | 8 |
| Total Square Feet: | 9,402 |
| Default Inflation Rate: | 3.0% |

| | Component | Current Total Replacement Cost | Expected Annual Rate of Inflation | Current Age | Total Expected Useful Life | Initial Replacement Year | Planned Expenditures by Year | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
|----|--|--------------------------------|-----------------------------------|-------------|----------------------------|--------------------------|------------------------------|-----------|---------|----------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|---------|--------|--------|--------|----------------|--|--|--|--|
| | | | | | | | Code | Emergency | Code | Deferred | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 | 10 | 11 | 12 | 13 | 14 | 15 | 16 | 17 | 18 | 19 | 20 | Revitalization | | | | |
| | | | | | | | | | | | 2013 | 2014 | 2015 | 2016 | 2017 | 2018 | 2019 | 2020 | 2021 | 2022 | 2023 | 2024 | 2025 | 2026 | 2027 | 2028 | 2029 | 2030 | 2031 | 2032 | | | | | |
| 1 | Radiators | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 2 | Unit Temperature Controls | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 3 | Air Conditioning Unit / Sleeve | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 4 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 5 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 6 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 7 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 8 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 9 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 10 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 11 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 12 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 13 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 14 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 15 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 16 | Other | | | | | 2013 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 17 | New Thermostats | 3,360 | | varies | 15 | 2013 | | | | 3,360 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | | |
| 18 | Replace Domestic Hot Water Heaters | 9,720 | | varies | 12 | 2018 | | | | 0 | 0 | 0 | 0 | 0 | 11,268 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 16,066 | 0 | 0 | | | | | | |
| 19 | Replace Hot Water Baseboards | 11,200 | | 22 | 20 | 2026 | | | | 11,200 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 19,639 | | | | | | |
| 20 | Replace Hot Water Boilers | 21,704 | | 22 | 30 | 2021 | | | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 27,494 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 21 | Remove 8 Abandoned Heat Recovery Units | 12,000 | | 1 | 1 | 2013 | | 5 | 12,000 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | | | | | |
| 22 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 23 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 24 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 25 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 26 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 27 | Annual Planned Expenditures | | | | | | 0 | 12,000 | 14,560 | 0 | 0 | 0 | 0 | 0 | 11,268 | 0 | 0 | 27,494 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 5,235 | 0 | 16,066 | 0 | 19,639 | 0 | | | | |
| 28 | Cumulative Reserve Balance | | | | | | 0 | (67,400) | 819,859 | 807,903 | 773,530 | 630,815 | 590,640 | 572,017 | 572,017 | 572,017 | 391,705 | 391,705 | 360,816 | 360,816 | 343,707 | 285,862 | 285,862 | 214,657 | 198,488 | 182,422 | 114,844 | 42,600 | | | | | | | |

Appendix A: Statement of Delivery

Our Capital Needs Assessment (the "CNA" or the "Report") on the subject property is delivered subject to the following terms and conditions:

1. This report and analysis are based upon observations for the visible and apparent condition of the building and its major components on the date of the fieldwork. Although care has been taken in the performance of this assessment, ON-SITE INSIGHT, Inc. (and/or its representatives) makes no representations regarding latent or concealed defects that may exist and no warranty or guarantee is expressed or implied. This report is made only in the best exercise of our ability and judgment.
2. We have undertaken no formal evaluation of environmental concerns, including but not limited to asbestos containing materials (ACMs), lead-based paint, chlorofluorocarbons (CFCs), polychlorinated biphenyls (PCBs), and mildew/mold.
3. Conclusions in this report are based on estimates of the age and normal working life of various items of equipment and/or statistical comparisons. Actual conditions can alter the useful life of any item. When an item needs immediate replacement depends on many factors, including previous use/misuse, irregularity of servicing, faulty manufacture, unfavorable conditions, Acts of God and unforeseen circumstances. Certain components that may be working when we made our inspection might deteriorate or break in the future without notice.
4. To prepare this report, we used historic data on capital activities and costs, blueprints (when available), and current prices for capital actions. We have not independently verified this information, have assumed that it is reliable, but assume no responsibility for its accuracy.
5. Unless otherwise noted in the report, we assume that all building components meet code requirements in force when the property was built.
6. If accessibility issues are referenced in the report, the site elements, common areas, and dwelling units at the development were examined for compliance with the requirements of the Uniform Federal Accessibility Standards (UFAS), and for Massachusetts properties, the Massachusetts Architectural Accessibility Board (AAB). The methodology employed in undertaking this examination is adapted from a Technical Assistance Guide (TAG-88-11) titled "Supplemental Information About the Section 504 Transition Plan Requirements" published by the Coordination and Review section of the U.S. Department of Justice Civil Rights Division, and the AAB Rules and Regulations, 521 CMR effective July 10, 1987. The Guide also incorporates the requirements of UFAS, published April 1, 1988 by the General Services Administration, the Department of Defense, the Department of Housing and Urban Development, and the U.S. Postal Service. Changes in legislation and/or regulations may make some observations moot.
7. Response Actions and estimated costs of responses were developed by ON-SITE INSIGHT, Inc. If additional structural work is necessary, costs for some Response Actions may exceed estimates. Whenever the Response Action is to remove, reposition, or modify walls, a competent structural engineer should be retained before any work is done, because such investigation may disclose that a Response Action is either more costly than estimated, or is not possible.
8. Conclusions reached in this report assume current and continuing responsible ownership and competent property management.
9. Regular updates of this plan are recommended to ensure careful monitoring of major building systems and to adjust the program to accommodate unanticipated circumstances surrounding the buildings, operations, and/or occupants.